

March, 1998

VCR 98-02

Hitachi Home Electronics (America), Inc.
National Service

VCR
Page 1 of 1

MODELS: VT-MX221A (U71032889), VT-MX421A (U71066989),
VT-MX421AC (U71013401), VT-FX601A (U71005401),
VT-MX424A (U71018989)

SUBJECT: INSTALLATION OF KIT, PART NUMBER X480195

SYMPTOM: Within 15 seconds, unit shuts-OFF & Indicator indicates
ERROR CODE #1


When a VCR with above model number is serviced and its serial number is below the above serial number list, *Please install the Kit (Part Number X480195)*

PROCEDURE:

- 1.) Replace the Prism (Shown in Fig. 1) on the Deck Mechanism with the new one.
- 2.) Replace D511 with new one.

CAUTION: Please pay attention to the following when replacing D511.

- a) Do NOT apply any mechanical stress to the leads.
- b) Solder in D511 quickly, do NOT apply excessive heat.

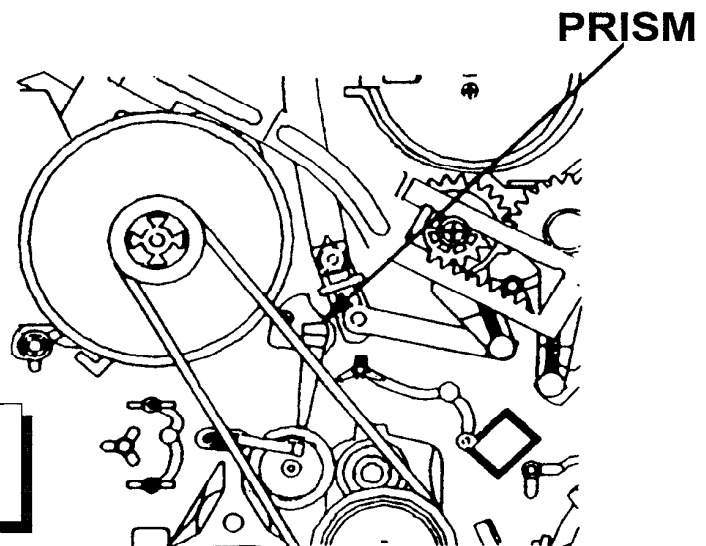

NOTE:
Installation Instructions are pre-packed with the Kit.

Figure 1

CONTENTS OF KIT X480195		
REF. NO.	DESCRIPTION	PART NUMBER
D511	LED SLR-938CV-7	TC10886
B74	PRISM MK6	TE12366